HS-422RT Accelerometer

4-20mA acceleration and PT100 temperature output via PUR Cable


Key Features

- · For use with PLC/DCS systems
- PT100 temperature output
- Waterproof
- · Resistant to oil

Industries

Building services, Pulp and Paper, Mining, Metals, Utilities, Automotive, Water, Pharmaceutical



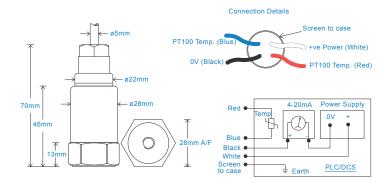

Technical Performance

Mounted Base Resonance 10kHz min **Acceleration Ranges** see: 'How To Order' table ±10% Nominal 80Hz at 22°C 10Hz (600cpm) to 5kHz (300kcpm) ± 5% Frequency Response - ISO10816 Base isolated Isolation Range see: 'How To Order' table Temperature Output PT100 (100 Ohms) Transverse Sensitivity Less than 5%

Mechanical

Case Material Stainless Steel Sensing Element/Construction PZT/Compression Mounting Torque 8Nm Weight 150gms (nominal) Maximum Cable Length 1000 metres Standard Cable Length 5 metres Screened Cable PUR - length to be specified with order Mounting Threads see: 'How To Order' table Submersible Depth 100 metres max. (10 bar)

Electrical

Current Output 4-20mA DC proportional to acceleration
Supply Voltage 15-30 Volts DC (for 4-20mA)
Settling Time 2 seconds
Output Impedance Loop Resistance 600 Ohms max. at 24 Volts
Case Isolation >10s Ohms at 500 Volts

Environmental


 Operating Temperature Range
 -25 to 90°C

 Sealing
 IP68

 Maximum Shock
 5000g

 EMC
 EN61326-1:2013

Typical Frequency Response




Applications

Fans, Motors, Pumps, Compressors, Centrifuges, Conveyors, Air Handlers, Gearboxes, Rolls, Dryers, Presses, Cooling, VAC, Spindles, Machine Tooling, Process Equipment

Vibration sensor should be firmly fixed to a flat surface (spot face surface may be needed to be produced and cable anchored to sensor body.)



How To Order

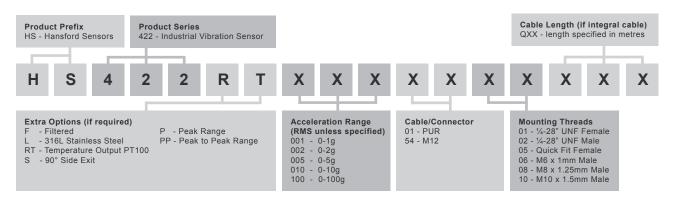



www.hansfordsensors.com sales@hansfordsensors.com



